

Manhole Inspection Summary

Manhole # S11GG1009MH

Printed On: 4/16/2009

Page 1 of 4

Inspection ☐ Is Incomplete Rating: **4) Poor**

Record Plat: **11GG1** Node: **009** Status: **Found**

Insp Date: **2/5/09 11:26 AM**

Incomplete Comments

Crew: **ADS4**
Inspector: **ADS1**
Firm: **ADS**

Location Address: **2920 BOARMAN AVE**

Cross Street: **WILLOWDALE AVE**

Manhole Type: **Inline** Location: **Roadway** Ground Conditions: **Dry**

☐ Prev. Rehab Weather: **Dry** Subject To Ponding: **Sheeting**

Comments

Cover Shape: **Circular** Diameter: **24** (in.) Length: (in.) Dist A/B Grade: **0** (in.)

Type: **Sanitary** Condition: **Sound** Cover Material: **Cast Iron**

Properties: ☐ Bolted ☐ Vented ☐ Water Tight ☐ Water Tight Insert

Frame Offset: **0** (in.) Condition: ☒ Sound ☐ Cracked ☐ Leaks

Chimney / Frame Adjustment ☒ Exists Material: **Brick and Concrete** ☒ Parged Height: **4** (in.)

Condition: ☐ Sound ☒ **Cracked** ☐ Root Intrusion ☒ **Loose Brick** ☒ **Deteriorated**

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Corbel Material: **Brick** ☐ Parged Type: **Concentric/Eccentric**

Condition: ☐ Sound ☒ **Cracked** ☐ Root Intrusion ☐ Loose Brick ☒ **Deteriorated**

Infiltration: ☐ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☒ **Wall**

Barrel Material: **Brick** ☐ Parged

Shape: **Circular** Diameter: **42** (in.) Length: (in.)

Condition: ☐ Sound ☒ **Cracked** ☐ Root Intrusion ☐ Loose Brick ☒ **Deteriorated**

Infiltration: ☐ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☒ **Wall**

Bench ☒ Exists Material: **Brick** ☐ Parged

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

Channel Material: **Brick** ☐ Parged

Channel Exposure: **Fully Open** Junc Dist: **0** nearest .5 ft. Azimuth:

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

Steps Count: **5** Missing: **0** ☒ **Corroded**

Surcharge ☐ Evidence Of Surcharge Depth: **1** (ft.) ☐ Active Surcharge Present

Location View



Top View



SHEETING




EVIENCE OF INFLOW DUE TO
SHEETING FROM CROWN OF
ROADWAY

Defect 6



CRACKED BRICKS IN DETERIORATED
BARREL-INFILTRATION

Defect 5

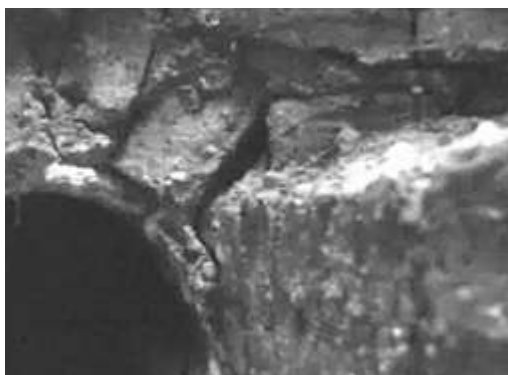

MISSING MORTAR IN DETERIORATED
PIPE SEAL

Defect 1



CORBEL WALL HAS 1FT CRACK AT TIP
OF YELLOW RULER-INFILTRATION

Defect 4



DEBRIS ON BENCH

Defect 2



MISSING BRICKS IN CHIMNEY AND
DETERIORATED AND MISSING
MORTAR

Defect 3



CORRODED BOTTOM STEP

Manhole Inspection Summary

Manhole # S11GG1009MH

Printed On: 4/16/2009

Page 4 of 4

8 in. Circular Gravity Sewer
Pipe Out @ 12 O'Clock

12 O'Clock Outflow



Pipe Height: **8.4** (in.) Rod and Bar (Angled)
Pipe Material: **Clay** ☐ Pipe Lined
Invert Depth: **9.17** (ft.) Flow Characteristics: **Slow**
Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease
Silt Depth: (in.) Deposits Extent:
Infiltration: **None** Pipe Seal Cond: **Cracked**

Drop: **None**

Connects To: **Connecting Node Not Available**

☐ Possible Illicit Connection

8 in. Circular Gravity Sewer
Pipe In @ 6 O'Clock

6 O'Clock Inflow



DETERIORATING PIPE SEAL MISSING
MORTAR

Pipe Height: **8.4** (in.) Rod and Bar (Angled)
Pipe Material: **Clay** ☐ Pipe Lined
Invert Depth: **9.08** (ft.) Flow Characteristics: **Slow**
Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease
Silt Depth: (in.) Deposits Extent:
Infiltration: **None** Pipe Seal Cond: **Cracked**

Drop: **None**

Connects To: **Connecting Node Not Available**

☐ Possible Illicit Connection